

## Danger of incorrect application of tensioning pulleys 531 0054 30 and 531 0626 30

**Manufacturer:**

Opel, Vauxhall, Holden

**LuK AS Part No.:** 531 0054 30  
531 0626 30

**OE-No.:** 56 36 738  
56 36 729

**Manufacturer No.:** 979195  
979488



**Fig. 1:** 531 0626 30 (979488)



**Fig. 2:** 531 0626 30 (979488)

When installing the above-listed tensioning pulleys, **correct** vehicle application must be ensured.

Both models appear to be identical from the outside.

The tensioning pulley **531 0626 30** has an extended tensioning range, as well as a higher-temperature bearing.

The tensioning pulleys can be distinguished by the manufacturer number stamped on the rear face (**fig. 2, arrow**).

The pre-tensioning force and the damping of the tensioning pulleys are different!

Incorrect assignment could cause the toothed belt to jump, resulting in damage to the engine.

Appropriate spare parts can be found in our on-line catalogue at [www.Schaeffler-Aftermarket.com](http://www.Schaeffler-Aftermarket.com) or at [www.RepXpert.com](http://www.RepXpert.com).

Issued 11.2007  
**INA 0005**

Technical subject to change  
© 2007 LuK-Aftermarket Service oHG

**For further information:**

Phone: +44 (0) 14 32 264 264\*

Fax: +44 (0) 14 32 275 146

Info@LuK-AS.co.uk

[www.Schaeffler-Aftermarket.com](http://www.Schaeffler-Aftermarket.com)

\* Calls from within the UK 08457 001100

