



PI 1961

For technical personnel only!

1/2

PRODUCT INFORMATION

NEW INTAKE MANIFOLDS IN RANGE

PLASTIC INTAKE MANIFOLDS WITH FLAP ADJUSTMENT

With Pierburg's OE expertise in air supply, Motorservice has extended its product range with a series of intake manifolds with flap adjustment.


These plastic intake manifolds have been developed to OE specifications and supplement the existing range of magnesium and aluminium intake manifolds.

Previously, many of these parts could only be purchased from an OEM along with all the attachments. In many cases, Motorservice now offers the actual intake manifold separately as a spare part.

THE REPAIR SOLUTION

Damage to an intake manifold is often due to carbonised or worn out flaps. The attachments, such as drive modules and solenoid valves, are generally still completely fine.

So you only have to replace the actual faulty component. This enables you to repair faulty components on plastic intake manifolds cost effectively – using quality parts from a premium manufacturer.

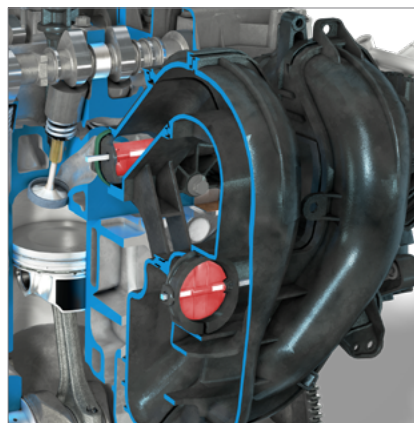

Flaps on the intake manifold



The Motorservice range also includes compatible attachments for specific intake manifolds, for example electric drive modules.



NEW INTAKE MANIFOLDS IN RANGE

Ref. no.*	OEM	Pierburg no. Module ¹⁾	Pierburg no. Component ²⁾	Vehicle	Engine	Model year
06J 133 201 BH 06J 133 201 AS 06J 133 201 BD	VAG		7.10131.00.0 (SR) ³⁾	A3, Alhambra, Altea, Beetle, CC, EOS, Golf VI, Jetta III, Leon, Octavia II, Passat, Q3, Scirocco, Sharan, Superb II, Tiguan, TT, Yeti	1.8, 2.0 l (petrol)	2004 - 2015
059 129 711 BQ 059 129 711 CK 059 129 711 CG	VAG Porsche	7.10315.04.0	7.10131.01.0 (SR) 7.06870.01.0 (EAM)	A4, A6, A8, Phaeton, Q7, Touareg Cayenne	2.7, 3.0 l (diesel) 3.0 l (diesel)	2003 - 2015 2009 - 2010
059 129 712 BQ 059 129 712 BE 059 129 712 BL	VAG Porsche	7.10315.05.0	7.10131.02.0 (SR) 7.06870.01.0 (EAM)	A4, A6, A8, Phaeton, Q7, Touareg Cayenne	2.7, 3.0 l (diesel) 3.0 l (diesel)	2003 - 2015 2009 - 2010
03L 129 711 E	VAG	7.10315.07.0	7.10131.03.0 (SR) 7.06870.02.0 (EAM)	A3, A4, A5, A6, Q5, TT	2.0 l (diesel)	2003 - 2009
03L 129 711 AG	VAG	7.10315.08.0	7.10131.11.0 (SR) 7.06870.02.0 (EAM)	A3, A4, A5, A6, Q5, TT	2.0 l (diesel)	2009 - 2017
4FM56-9424-FU 5164230	Ford		7.10131.04.0 (SR)	C-Max, Focus II, Focus C-Max, Galaxy, Mondeo IV, S-Max	1.8, 2.0 l (petrol)	2004 - 2015
31359880	Volvo			C30, S40 II, S80 II, V50, V70 III		2004 - 2012
A 612 090 19 37 A 612 090 03 37 A 612 090 10 37	Mercedes-Benz		7.10131.05.0 (SR)	C Class, E Class, G Class, M Class	2.7, 3.0 l (diesel)	1999 - 2009
A 611 090 36 37 A 611 090 13 37 A 611 090 23 37	Mercedes-Benz		7.10131.06.0 (SR)	C Class, E Class	2.2 l (diesel)	1998 - 2007
11 61 7 800 585 11 61 7 790 701	BMW		7.10131.07.0 (SR)	3, 5, 6, X3, X5, X6	3.0 l (diesel)	2001 - 2013
A 651 090 00 37	Mercedes-Benz Jeep		7.10131.08.0 (SR)	A Class, B Class, C Class, E Class, G Class, M Class, S Class, V Class, Sprinter Compass	2.2 l (diesel)	2003 - 2016 2010 -
A 271 090 30 37 A 271 090 28 37	Mercedes-Benz		7.10131.09.0 (SR)	C Class, E Class	1.6, 1.8 l (petrol)	2007 - 2016
11 61 8 511 363 11 61 7 000 088	BMW		7.10131.10.0 (SR)	3, 5, 7, X5, X6	3.0 l (diesel)	2005 - 2017
11 61 7 807 991	BMW		7.10131.12.0 (SR)	1, 2, 3, 4, 5, X1, X3, X5	2.0 l (diesel)	2007 - 2017

Abbreviations & legend:

SR = Intake manifold


EAM = Electric drive module

1) These item numbers cannot be ordered; only supplied in parts list.

The item numbers are intended to link the vehicle manufacturer reference number to the components that make up the complete intake manifold module.

You can order these components separately from Motorservice.

2) Individual component as per parts list

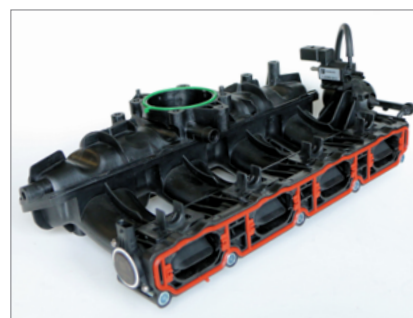

3) Intake manifold 7.10131.00.0 including original flap potentiometer and switchover valve 7.03280.04.0.

All content including pictures and diagrams is subject to change. For assignment and replacement, refer to the current catalogues or systems based on TecAlliance.

* The reference numbers given are for comparison purposes only and must not be used on invoices to the consumer.